16CH STEPPING MOTOR CONTROLLER

PM16C-04,04S

USER'S MANUAL

(2449,2519 VER.3)



APPLICATION OF ELECTRONIC DEVICES

TSUJI ELECTRONICS CO., LTD

3739 Kandatsu-machi Tsuchiura-city Ibaraki-Pref 300-0013 Japan Phone +81-(0)29-832-3031 fax +81-(0)29-832-2662 URL http://www.tsujicon.jp E-mail info2@tsuji-denshi.co.jp

COMMAND LIST (GP-IB, RS232C) COMPLETELY COMPATIBLE TO PM16C-02N, -02Z COMMAND EXCEPT "*" MARKED COMMAND

MODE	COMMAND	REPLY ETC.
R/L	S 1 R	remote mode change
R/L	S 1 L	local mode change
R/L	S 1 0	R motor channel No. reply of "A, B, C, D" figure *
R	S 1 1	set motor channel to A
	S 1 2	set motor channel to B
	S 1 3 0 1	SRQ set when A motor stopped
	S 1 3 0 2	SRQ set when B motor stopped
	S 1 3 0 4	SRQ set when C motor stopped *
	S 1 3 0 8	SRQ set when D motor stopped *
	S 1 3 0 F	SRQ when A,B,C,D motor stopped (combination available) a part *
	S 1 3 8 0	SRQ cancel (also with GP-IB COMMAND "IFC")
R/L	S 1 4	SRQ flag read R (HEX)
R	S 1 5	set motor channel to C *
``	S 1 6	set motor channel to D *
R/L	S 2 0	A position data read reply: R (HEX)
	S 2 0 D	A position data read reply: ± D D D D D D D (DEC) *
	S 2 1	A position status read reply: R (HEX)
	S 2 2	B position data read reply: R (HEX)
	S 2 2 D	B position data read reply: ± D D D D D D D (DEC) *
	S 2 3	B position status read reply: R (HEX)
	S 2 4	C position data read reply: R (HEX) *
	S 2 4 D	C position data read reply: ± D D D D D D D (DEC) *
	S 2 5	C position status read reply: R (HEX) *
	S 2 6	D position data read reply: R (HEX) *
	S 2 6 D	D position data read reply: ± D D D D D D D (DEC) *
	S 2 7	D position status read reply: R (HEX) *
R	S 3 0	A position 2 byte command
		: command 08:+jog,
		OE:+scan OF:-scan 16:pause on 17:pause off
		18:hold off 19:hold on 1E:+scan & HP stop 1F:-scan & HP stop 40:slow stop 80:EM.stop
	S 3 1	B position 2 byte command
		: command
		08:+jog, 09:-jog 0C:+CSPD scan 0D:-CSPD scan
		OE:+scan
		40:slow stop 80:EM.stop
	S 3 2 X X X	A position 8 byte command
	XXX	XXXXXX:HEX position data
	OR S 3 2 X X X	command 10:CSPD REL.IDX 11:CSPD ABS.IDX
	XXX B	12:REL.IDX 13:ABS.IDX auto backlash correction with "B"
	S 3 2	A position DEC index command *
	± DDDDDDD or S 3 2	: A: absolute index scan, R: relative index scan ± DDDDDDD:DEC position data
	± DDDDDDDB	auto backlash correction with "B"
	S 3 3 X X X	B position 8 byte command
	XXX	XXXXXX:HEX position data
	OR S 3 3 X X X	: command 10:CSPD REL.IDX 11:CSPD ABS.IDX
	XXX	12:REL.IDX 13:ABS.IDX auto backlash correction with "B"
	S 3 3	B position DEC index command *
	± DDDDDDDD or	: A: absolute index scan, R: relative index scan
	S 3 3 ± DDDDDDDB	±DDDDDDD:DEC position data auto backlash correction with "B"
<u> </u>		date backrash correction with b

MODE	COMMAND	REPLY ETC.
R	S 3	speed change S34:L SPEED S35:M SPEED S36:H SPEED
	S 3 8	C position 2 byte command
		: command 08:+jog, 09:-jog 0C:+CSPD scan
		OE:+scan OF:-scan 16:pause on 17:pause off
		18:hold off 19:hold on 1E:+scan & HP stop 1F:-scan & HP stop 40:slow stop 80:EM.stop
	S 3 9	D position 2 byte command
		: command 08:+jog, 09:-jog 0C:+CSPD scan 0D:-CSPD scan
		OE:+scan OF:-scan 16:pause on 17:pause off
		18:hold off 19:hold on 1E:+scan & HP stop 1F:-scan & HP stop 40:slow stop 80:EM.stop
	S 3 A X X X	C position 8 byte command
	X X X OR	XXXXXX:HEX position data : command
	S 3 A X X X X X X B	10:CSPD REL.IDX 11:CSPD ABS.IDX 12:REL.IDX 13:ABS.IDX auto backlash correction with "B"
	S 3 A ± DDDDDDD or S 3 A	C position DEC index command : A: absolute index scan, R: relative index scan ± DDDDDDD:DEC position data
	± DDDDDDDB	auto backlash correction with "B"
	S 3 B X X X X X X OR	D position 8 byte command X X X X X X :HEX position data : command
	S 3 B X X X X X X B	10:CSPD REL.IDX 11:CSPD ABS.IDX 12:REL.IDX 13:ABS.IDX auto backlash correction with "B"
	S 3 B	D position DEC index command *
	± DDDDDDD or S 3 B	: A: absolute index scan, R: relative index scan ± DDDDDDD:DEC position data
	± DDDDDDDB	auto backlash correction with "B"
R/L	S 4 X Y	data read command X: channel No.(0-F) Y: data No.(0-F) reply: R (HEX) 3 byte data from read data address
	S 4 X P S	position data read X: channel No.(0-F) PS: position data read * reply: ± D D D D D D D (DEC)
	S 4 X F L	forward DGLS read X: channel No.(0-F) FL: forward DGLS read * reply: ± D D D D D D D (DEC)
	S 4 X B L	backward DGLS read X: channel No.(0-F) BL: backward DGLS read * reply: ± D D D D D D D (DEC)
R	S 5 X Y	data write command X: channel No. Y: data No. : write data (HEX)
	S 5 X P S ± DDDDDDD	position data write X: channel No.(0-F) PS: position data write * ± DDDDDDDD : write data (DEC)
	SSXFL	forward DGLS write X: channel No.(0-F) FL: forward DGLS read *
	± DDDDDDDD S 5 X B L	± DDDDDDD: write data (DEC) backward DGLS write X: channel No.(0-F) BL: backward DGLS read *
D.//	± DDDDDDD	± DDDDDDD: write data (DEC)
R/L	S 6	status & LS read (a row of data is B,A,D,C for "-02N" compatible) reply: R : HEX CODE REM/LOC, LIMIT SW *
	BXhhhh	backlash correction data(for CH X) set (h:HEX,D8F1~270F) *
	BXH?	backlash correction data(for CH X) read reply: R h h h h (HEX) *
	BX ± DDDD	backlash correction data(for CH X) set 0~±9999 (decimal)
D.//	BX?	backlash correction data(for CH X) read reply: ± D D D D (DEC)
R/L	PIO?	PIO port status read * reply: PIO :PIO port COM :PIO communication port
	PIO	set PIO port as a normal PIO port *
	COM	set PIO port as a PIO communication port *
	R D	data read from PIO port
	WXXYY	data write to PIO port XX: port 1 data YY: port 0 data(HEX) *
	VER?	read version information reply: 1.05 00-07-20

Added command March 3, 2001

MODE	COMMAND	REPLY ETC.
R	FHPA	Find Home Position of channel A
	FHPB	Find Home Position of channel B
	FHPC	Find Home Position of channel C
	FHPD	Find Home Position of channel D
	RTHPA	Return Home Position of channel A
	RTHPB	Return Home Position of channel B
	RTHPC	Return Home Position of channel C
	RTHPD	Return Home Position of channel D
	DPX	change start direction of channel X to positive
	DNX	change start direction of channel X to negative
	GFXDDDD	write offset data X: channel D: decimal
	SPHXDDDDD	write HSPD X: channel DDDDD: PPS unit speed data
	SPMXDDDDD	write MSPD X: channel DDDDD: PPS unit speed data
	SPLXDDDDD	write LSPD X: channel DDDDD: PPS unit speed data
	SPCXDDDDD	change speed while scanning X: channel DDDDD: PPS unit speed data
R/L	G?X	read home position status X:0 - F(channel) reply RHH :H ASCII hex
	GF?X	read offset data X: channel reply RDDDD :d ASCII dec.
	HP?X	read home position X: channel reply ± DDDDDDD ASCII 7 dec.
	SPH?X	read HSPD of channel X reply RDDDDD D: ASCII 5 dec.
	SPM?X	read MSPD of channel X reply RDDDDD D: ASCII 5 dec.
	SPL?X	read LSPD of channel X reply RDDDDD D: ASCII 5 dec.

CONTENTS

1	. Abstract	page
		1
	2) Concept of PM16C control · · · · · · · · · · · · · · · · · · ·	2
2	. Panel layout	
	1) Front panel layout · · · · · · · · · · · · · · · · · · ·	3
	2) Function SW (in detail) · · · · · · · · · · · · · · · · · · ·	3
	3) Rear panel layout ···········	4
	4) Connectors on the rear panel · · · · · · · · · · · · · · · · · · ·	4
3	. Setting the motor characteristics	·
_	1) Power on · · · · · · · · · · · · · · · · · ·	5
	2) Set data · · · · · · · · · · · · · · · · · ·	5
	3) Prepare the data setting · · · · · · · · · · · · · · · · · · ·	6
	4) Procedure of data setting ••••••••••••••••••••••••••••••••••••	6
	A. Digital CW LS	6
	B. digital CCW LS · · · · · · · · · · · · · · · · · ·	
		6
	C. HSPD (Highest Speed) · · · · · · · · · · · · · · · · · · ·	7
	D. MSPD (Mid Speed) · · · · · · · · · · · · · · · · · · ·	8
	E. LSPD (Low Speed) · · · · · · · · · · · · · · · · · · ·	8
		8
	G. LMSW (Limit SW etc.) · · · · · · · · · · · · · · · · · · ·	8
	H. Jogging count	9
	I. Home position data • • • • • • • • • • • • • • • • • •	9
	5) Finish to set data · · · · · · · · · · · · · · · · · ·	1 0
4	. Local mode driving	
	1) Speed selection · · · · · · · · · · · · · · · · · · ·	
	2) Changing the driving mode · · · · · · · · · · · · · · · · · · ·	1 0
	HP stop mode	
	REL and ABS indexed SCAN	
	Continuous SCAN	
	3) Channel selection · · · · · · · · · · · · · · · · · · ·	1 2
	4) Jog driving · · · · · · · · · · · · · · · · · · ·	1 2
	5) Position data preset · · · · · · · · · · · · · · · · · · ·	1 2
	6) Synchronous driving · · · · · · · · · · · · · · · · · · ·	13
	7) Auto hold-off · · · · · · · · · · · · · · · · · ·	
	8) Inhibiting Jog · · · · · · · · · · · · · · · · · · ·	1 /
	9) Hand box operation · · · · · · · · · · · · · · · · · · ·	1 1
5	Remote mode driving	. 4
J	1) External communication over PIO port(omitted) · · · · · · · · · · · · · · · · · · ·	1 /
	2) RS232C, GP-IB data communication · · · · · · · · · · · · · · · · · · ·	
	2-1) Command in detail · · · · · · · · · · · · · · · · · · ·	14
	a) Channel select, channel read and remote/local · · · · · · ·	
	change command S 1 · · · · · · · ·	16
	b) Data & status read command S 2 · · · · · · · · · · · · · · · · · ·	16
		1 7
	d) Data read out command S 4 · · · · · · · · ·	2 1
	2-2) Procedure of data communication over GP-IB, RS232C or LAN	
	communication ports · · · · · · · · · · · · · · · · · · ·	2 4
	2-3) Sample program of data communication · · · · · · · · · · · · · · · · · · ·	2 4
6	. Auto backlash elimination	
	1) What is the auto backlash elimination ••••••••••	2 4
	2) Command reference · · · · · · · · · · · · · · · · · · ·	2 4
	3) When you use backlash elimination · · · · · · · · · · · · · · · · · · ·	2 5
7	. Home position detection in remote mode (omitted) · · · · · · · · · · · · · · · · · · ·	2 5
	. 16 bit digital data IN/OUT (omitted) · · · · · · · · · · · · · · · · · · ·	

9.	Version information • • • • •	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	2	5
10.	Another added command (omitted)	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	2	5
11.	Additional function																								
	Pulse output style change	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	2	6
12.	Connection with outer equipment	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	2	7
13.	Specification · · · · · · ·	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	2	8

PM16C-04, PM16C-04S User's Manual

1 . Abstract

PM16C-04, PM16C-04S, designed as an upper version of PM16C-02Z (or PM16C-02N), has same communication command and similar operation as PM16C-02Z (or PM16C-02N). PM16C-04, PM16C-04S can control 4 motors at a time, although PM16C-02Z (or PM16C-02N) can control 2 motors at a time.PM16C-04 has a 10BASE-T Ethernet interface for LAN use. PM16C-04S is a low cost type without LAN inter face.

1) Characteristics


One PM16C can control less than 16 stepping motors.

- * Characteristics (HSPD, MSPD, LSPD, RATE, LMSW) of each motors can be set as you like
- * Any channel can be inhibited to operate.

Four motors can be driven synchronously.

- * The four motors can be started at the same time.
- * Limit SW status, Pulse out status and Position of the four motors are shown on the front panel.

Driving Mode

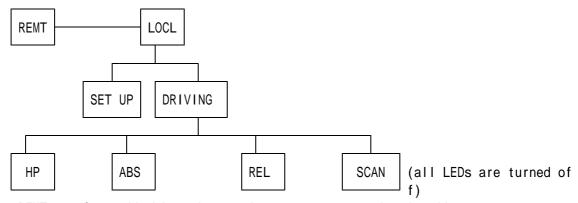

REMT : Controlled by other equipment over communication line

LOCL :Controlled by Switches on the front panel SET UP :Setting of the motor driving procedure

DRIVING : Motor driving is possible in this mode(set up lump turn off)

SCAN :Simple driving (can be stopped only by Limit SW or Stop SW on front

panel)

ABS :Absolute Position Set Driving
REL :Relative Position Set Driving
HP :Home Position Stop Driving

- * Present driving mode is shown on the front panel by LED
- * Modes, and position are memorized as back up data by battery for five years.
- * The data can be set in REMT mode, as above shown.
- * Use the data communication forms as below.

1 PIO
2 GP-IB
3 RS232C
4 Handy console (PM16-HD1:option)
5 Ethernet (LAN)

Motor is stopped, when

- a. Limit Switch is detected.
- b. Home Position Switch is detected.
- c. Software Limit Switch is detected.
- d. stop switch is pushed.

- * Enable/disable can be set for each motor. (a,b,c)
- * Contact type can be set for each motor. (a,b,c)
- * (d) function is enable in both remote/local.
- * (c) is a function in which the motor is stopped at the point set by front panel or by remote operation.
- * In the case of a \sim d, the motor is stopped through slow stopping process to prevent detuning.

Hand box operation

- * Only 4 channel can be operated, which are displayed on the front panel.
- * CW/CCW jog operation is possible.
- * By use of the Hand box, you can operate PM16C, while you watch the machine moving.

If you need more multi-function, handy console :PM16-HD1 is useful. Please contact us, and order please.

Hold off: When motor is stopped, power is automatically turned off.


- * Each channel can be set to take the hold-off function, or not.
- * The hold-off can be set externally by command through communication line.

Jog switch is used for:

- a. Any numbers of steps $(1 \sim 9999)$ driving.
- b. Inching driving; Only when you keep to push the jog SW, Jogging continues.

2) Concept of PM16C control


Stepping motor controller; PM16C-04(-04S) has a CPU which controls the hole of the system, four CPU which control the stepping motors. The connections between the four CPU and 16 of stepping motors are changed properly. Present positions, p resent velocities, differential velocities in starting and stopping phase, etc. ar e stored in the memories as battery back up, which are read out and renewed any time you need.

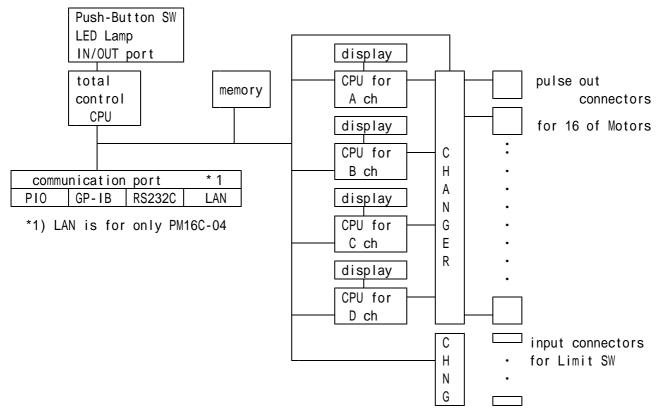

2 . Panel layout

1) Front panel layout

Fig.1 Front panel layout

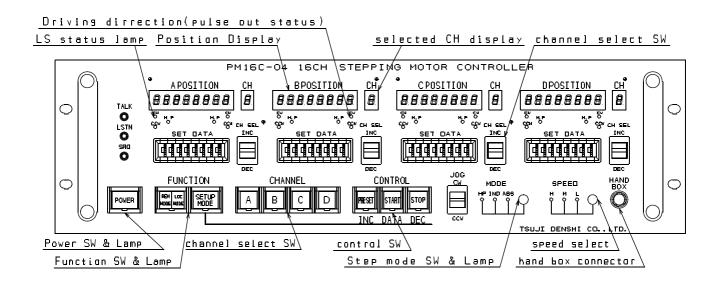

2) Function SW (in detail)

LOCL

MODE MODE

MODE

PRESET

INC

REMT

REMT : External control mode

LOCL : Manual driving mode. (operated by panel SW)

If you keep the SW to be pushed, and turn the power on,

then Motor Speed is set to be default data.

Default: HSPD=3700PPS, MSPD=650PPS, LSPD=10PPS,

RATE=300mS/1000PPS, hold off mode, LS/N.0

jog pulse counts=1,CWLS=+1000000,CCWLS=-1000000

* Each pushing changes the remote/local alternately.

It can be also operated externally.

SET UP : If you push this SW when motor remains stationary in LOCL,

then the mode is changed into set up mode.

Please set the data for motor driving in this mode.

By these SWs you can select which motor is driven.

Available only in local mode.
Each pushing changes lamp on/off alternately.
Lamp on CH can be driven at the same time.

In SET UP mode you can choose display window.

PRESET: a. In DRIVING mode: data of digital SWs are set as present data.

By A/B/C/D SW, you can select the CH to which data are preset.

b. In set up mode: The values of data are increased.

(Large value data such as the Soft ware LS is set by digital SW.)


START ; a. In DRIVING mode: Function is changed in accordance with mode display lamp

		mode Imp	mode	movement when START sw is on
	START	all off	scan	prepare scan. waiting to set direction
	START	ABS on	ABS	scan start to ABS. pos. set by digital
		REL on	REL	scan start to REL counts set by digit.
		HP on	HP	home position moving *1,*2
	DATA	*4 1		d IID

*1 In scan and HP, scanning is prepared by pushing this SW. However, the scanning can not start without setting CW/CCW decision by jog SW.

*1 SW.

- *2 see page 9 about details for HP mode.
- b. In set up mode: Showing data are changed by this SW. Right after entering into set up mode, CW LS data is shown. And, CCW LS, HSPD, MSPD, RATE, LS status··· are shown next to next.

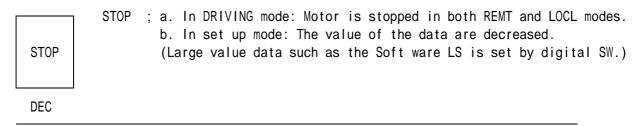


caution

- * mode change SW : ABS REL HP SCAN are circular changed.
- * speed change SW : L M H are circular changed.

 Changes unit (code / pps) in setup mode.
- 3) Rear panel layout

Fig.2 Rear panel layout

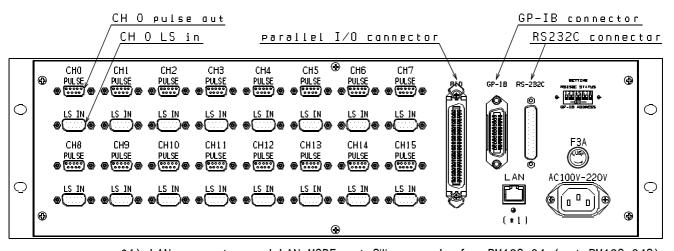

- *1) LAN connector and LAN MODE set SW are only for PM16C-04 (not PM16C-04S)
- 4) Connectors on the rear panel
 - PULSE (DE9S)
 Stepping pulse out for Motor Drivers.
 - 2. LS IN (DE9P)

Limit sw signal input for limit sw or photo sensor.

3. PIO (57-40500) PIO communication. Available for parallel In/Out port over GP-IB,RS232C communication.

4. GP-IB

GP-IB communication.

5. RS232C (DB25S)

RS232C communication.

6. DIP SW

Status setting for GP-IB,RS232C communication.

7. LAN MODE (only for PM16C-04)

Setting for Ethernet (LAN) mode.

8. LAN (only for PM16C-04)

10base-T connector for Ethernet.

9. F3A

Fuse holder for power supply. use 3A fuse.

10 AC100V

AC power supply. AC85V ~ AC264V 47~440Hz 50VA

3 . Setting the motor characteristics

In PM16C-04,-04S, each data of 16 stepping motors can be set and stored, which is kept as battery back up. The data are kept to be memorized until reset. Then, accurate control is realized for any system. In setting mode, pulse out is stopped. Data can not be set during motor moving.

1) Power on

When Power SW is turned on, status become to be default mode within 1 second.

	operation	driving	driving	speed
	mode	mode	position	setting
default	memorized	REL	memorized	MID

Other data are set as the value which are the one last time turned off the power, because the all of these data are kept by battery back up.

2) Set data

All channel data can be set individually.

set No.	data	meaning	
7	CW soft ware LS	stop when pulse count > data	
8	CCWsoft ware LS	stop when pulse count < data	
9	HSPD	high speed data (code)	unit select:
9	ПОРИ	high speed data (pps unit)	speed
Α	MSPD	mid speed data (code)	select PB
A	MOPD	mid speed data (pps unit)	value in pps:
b	LSPD	low speed data (code)	set by
D	LOPU	low speed data (pps unit)	Digital SW
С	RATE	speed up/down rate (see table 2 on p	age 11)
d	Limit SW status	limit sw (N.O, N.C), moving EN/DA, h	old off, etc.
Е	JOG step pulse	JOG step pulse in local mode	
	data for	b0:start dir. b1:sens.dir. b2:get	display:
F	home position moving	offset pulse (near hp)	mode change
		memorized home position	РВ

3) Prepare the data setting

In LOCL mode, set up mode is selected by set up SW.


Then, A position display shows the data.

By B,C,D select sw, you can change data display window.

If the channel No. (which you want to set the data) appears one of 4 display windows, select that window and set the data.

If it doesn't, you can select the channel by using INC/DEC SW under channel No. display window.

Caution) The display shows the number as HEX $(0 \sim F)$, then 6 and b might be complex. Please take care this point.

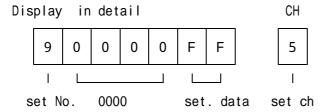

The channel you want to set data is shown in A(B,C,D) position display. The channel can be changed by INC/DEC SW under the display.

4) Procedure of data setting

A. Digital CW LS <u>setting No. 7</u> * Right after entering the set up mode

a) Push the data SW (START SW), and select the setting No. 7.

(7 is not shown, but it is after F.)


b) Set data by use of digital SW under the display window.

Write the data into the memory by INC SW (PRESET SW) or DEC SW (STOP SW).

The data's mean the absolute position where you want to stop the motor during

The data's mean the absolute position where you want to stop the motor during CW driving.

c) Channel can be changed by the SW under the display.

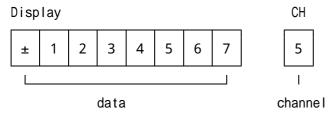


B. digital CCW LS

setting No. 8

a) Push the data SW (START SW), and select the setting No. 8 .

(8 is not shown, but it is after 7.)

- b) Set data by use of digital SW under the display window. Write the data into the memory by INC SW (PRESET SW) or DEC SW (STOP SW). The data mean the absolute position where you want to stop the motor during CCW driving.
- c) Channel can be changed by the SW under the display.

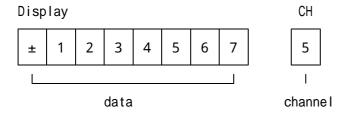

C. HSPD (Highest Speed)


Setting No. 9

Can choose code/pps unit by speed change PB. Once chosen it remains in MSPD, LSPD setting. (also after power on/off).

Even if you choose the code data, the pps unit data is set to new data automatically. But if you choose the pps data, the code data is not changed to new data.


(Setting code data)

- a) Push the data SW (START SW), and select setting No.9.
- b) Set data by use of INC SW (PRESET SW) or DEC SW (STOP SW). A relationship between data and speed can be known by use of table 1. 5pps to 40,000pps data are available.
- c) Channel can be changed by the SW under the display.

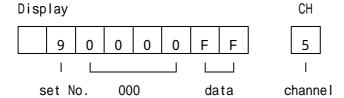

(Setting PPS unit data) PPS: pulse per second (P/S)

- a) Push the data SW (START SW), and select setting No.9.
- b) Set data by use of digital SW under the display window. Write the data into the memory by INC SW (PRESET SW) or DEC SW (STOP SW). 1pps to 100,000pps can be set.
- c) Channel can be changed by the SW under the display.

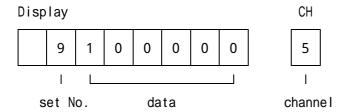

D. MSPD (Mid Speed)

Setting No. A

a) Push the data SW (START SW), and select setting No. A.

How to set the data is the same as the HSPD.

E. LSPD (Low Speed)

Setting No. B


a) Push the data SW (START SW), and select setting No. b .

How to set the data is the same as the HSPD.


- F. RATE (speed up/down rate) Setting No. C
- a) Push the data SW (START SW), and select setting No. C.
- b) Set the data by INC SW (PRESET SW) and DEC SW (STOP SW).

A relationship between data and rate can be known by use of table 2.


c) Channel can be changed by the SW under the display.

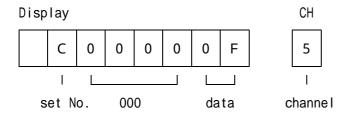

- G. LMSW (Limit SW etc.) Setting No.
- a) Push the data SW (AB SW), and select setting No.D.
- b) Set data by use of INC SW (PRESET SW) or DEC SW (STOP SW).
- c) LS status can be set, while you see the LED to know the present status. (turned on: LS on, turned off: LS off) (details are shown in "LS data structure")
- d) If highest bit is set to zero (<7FH), which means motor off, then CW and CCW LS lamps are switched to show that the motor can not be driven.
- e) Channel can be changed by the SW under the display.

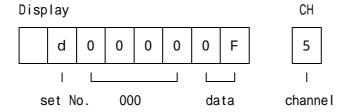

* LS data structure

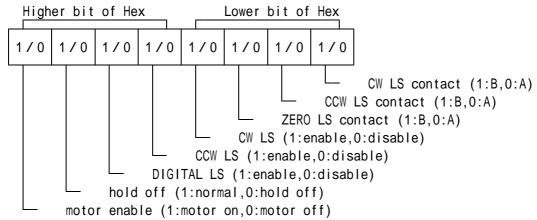

CW/CCW LS A/B contact type setting

When these bits are 1, they are B contacts. when they are 0, A contacts.

A contacts : when LS is struck, the contact becomes electrically to be CLOSE. It is normally open. (so it is also called as N.O contact)

Drawing: ———

B contacts: When LS is struck, the contact becomes electrically to be open. It is normally CLOSE. (so it is also called as N.C contact)

Drawing: _____

ZERO, CW and CCW LS enable

Each LS can be set to be enable or disable.

When this bit is 1, the LS is enable. When this bit is 0, the LS is disable.

Please care that motor can not stop when LS is kept to be disable.

Digital LS enable

digital LS can be also set to be disable or enable.

When this bit is 1, it is enable. When this bit is 0, it is disable.

If digital LS is enable, motor can stop at the absolute position where is internally set by digital SW (CW/CCW) as same as hardware LS.

hold off

IF some torque is required to keep the motor remaining stationary, power should be kept to be turned on.

But, if there is not such a requirement, some motor drivers can be hold off to prevent the heating up and to save the power.

When you use these types of drivers, motor can be more effectively driven by

this bit operation. When this bit is 1, hold off signal is disable so that power is kept to be turned on all time. When this bit is 0 in manual mode, the power is turned on 0.1s before jog starting, and turned off 0.1S after jog finishing.

* The motor, whose power is required to be hold off in remote mode, should be controlled by the sequence, in which the "hold off" is set to be disable before jog starting, and reset to be enable after jog finishing.

Motor enable

You can set some motors impossible to drive by use of this bit setting. When this bit is 1, it is normal driving mode that motor can be driven as you like.


When this bit is 0, motor can not be driven by any manual SW operation.

* If you set the motor impossible to drive by this way, the motor becomes that can not be driven by any remote operation.

H. Jogging count

Setting No. E

- a) Push the data SW (START SW), and select setting No. E.
- b) Set data by use of INC SW (PRESET SW) or DEC SW (STOP SW). The possible dates' range is $1 \sim 9999$.
- c) You can change the channel by the SW under the display.

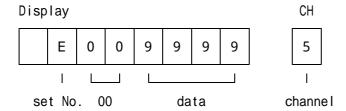

I. Home position data

Setting No. F

a) Push the data SW (START SW), and select setting No. F .

There are three data.


Just after selecting No.F, home position status of the channel are displayed. By the mode change PB, you can change the contents of the display. (contents: home position status, offset pulse, home position value)

(Home position status)

Only the start direction of auto home position searching is changeable.

If it is changed, home position found flag will be cleared.


- a) Change data by use of INC SW (PRESET SW) or DEC SW (STOP SW).
- b) You can change the channel by the SW under the display.

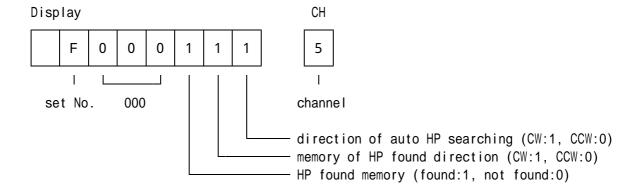

(Home position offset pulse)

Can change home position offset pulse data.


- b) Set data by use of digital SW under the display window. Write the data into the memory by INC SW (PRESET SW) or DEC SW (STOP SW). Data $0 \sim 9999$ can be set.
- c) Channel can be changed by the SW under the display.

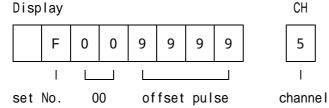

(Home position value)

Read only data.

a) You can change the channel by the SW under the display.

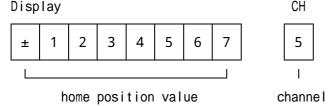

5) Finish to set data

Turn off the set up SW, and get back to driving mode.

4 . LOCAL mode driving

Only when remote/local SW is set to be local, the motor can be driven in local mode. If this SW is remote, you need to push the SW once, and reenter into local mode.

1) Speed selection

By use of speed selecting PB, any speed can be selected from the three speed that are preset in each channel, which are ${\sf HSPD}$, ${\sf MSPD}$ and ${\sf LSPD}$.

Starting speed of acceleration and final speed of deceleration is LSPD.

2) Changing the driving mode

By use of driving mode selecting PB, you can select the mode as you like: HP,REL,ABS and scan (scan mode is the case that all LED which show driving mode are turned off). Just after power on, REL mode is selected.

a. HP stop mode (HP mode lamp is flickering)

In this mode motor will stop when HP sensor on.

When sensor is on the moving direction and the value of home position are memorized. It is necessary that the scan speed is slower than the sensor reply speed.

You can choose the way to find home position as follows.

Status	method	pr	ocedure	accur	time	expl
not found yet	manua	ch. select	JOG or START+JOG		short	
(select ch. lamp is flickering)	semi auto	ch. select	START PB > 1Sec.		long	
found already (select ch. lamp is on)	semi auto	ch. select	START PB		short	

Find home position.

Manual detection.

1. Choose the channel which you wont to find home position.

In the HP STOP mode, can see if the channel already has home position by the selected channel lamp.

flickering : not found yet. lamp on : already found.

lamp off : not selected as a moving channel.

2. Move to the one side near home position from which you want to approach.

If you pass the home position in this process you must pass <u>without HP STOP mode</u>. You can't pass through the home position in the HP STOP mode.

3.Next move toward the home position in HP STOP mode (in slow speed if possible). 2 ways are available.

One is by using only JOG sw and the other is start PB + JOG sw.

Start ready status, which is prepared by start PB, can be cleared by STOP sw.

4.Detecting the up edge of home position sensor, motor will stop quickly and home position detecting procedure will finish.

After the finishing of home position detection the selected channel lamp status will change from flickering to continuous lamp on.

Direction from which it approached and the value of home position are memorized. The data about home position detection are stored as battery back up.

If the detection is done in high speed moving, notice the influence to the mechanic or detuning.

If overrun through the sensor occurred when stopped, the detection is failed. You should try the process once more.

Semi auto detection when no HP memory.

In this method the detection is done automatically by using CW, CCW limit sw. So the limit sw must work securely.

- 1.Select and move enable the channel you want to find home position.

 In HP STOP mode selected channel lamp that has no home position memory will flicker.
- 2. Press the START PB and the lamp will turn on.
 - (If you decide the moving direction with JOG SW, the method of home position detection is as the same above)
- 3. Pressing the PB more than 1 second, the motor will start to move toward some direction. Some direction means CCW direction as a default direction. Can change the default direction as you want. (The start direction is opposite one that is the approaching side of home position.)
 - If changed, CW, CCW should be CCW, CW below.
- 4. When CCW limit sw is turned on, the motor will slow down and stop, then return to the CW direction. If home position sensor turned on before CCW limit sw, go to 6th sentence.
- 5. When HP sensor turns on, the motor will slow down and stop, then return to the CCW direction.
- 6. When HP sensor turns off (or turns on then turns off), the motor will slow down and stop, then return to the CW direction and when HP sensor turns on, the motor will stop and finish the HP detection.
 - After HP detection flickering selected channel lamp will change to continuous turn on status. And also home position informations are memorized.
- 7. If CW limit sw turns on instead of HP sensor turns on, the detection process will be failed and finish.

It can also be forced to stop by stop PB.

Semi auto HP detection with HP memory

- 1.In HP STOP mode, selected channel lamp is continuously lighting when it has HP memory.
- 2.By pressing START PB, the motor starts to move automatically to the place that is home position plus (or minus) offset pulse.

Plus or minus is determined by the direction when last HP detection finished. Offset pulse can be set in advance between 0 to 9999.

The offset pulse can be set for each motor as the home position offset data. The default value of offset pulse is 100.

3. Next it move to HP slowly, when HP sensor turns on it stops.

The home position informations are re-memorized, so process is reliable after process.

In this process if the HP sensor doesn't turn on, while moving to HP even if it pass through out of HP +/- offset pulse, the HP detection process will be failed.

The HP memory will be cleared and selected channel lamp will be changed to flickering status.

If CW or CCW limit sw works, or STOP PB is pressed, HP detection process will also be stopped. But in this case the HP memory will be conserved.

b. REL and ABS indexed SCAN

In REL mode when START PB pressed the motor steps relatively by the digital sw data. In ABS mode it steps to the absolute data that the digital sw indicate. Can stop by limit switches or STOP PB.

c. Continuous SCAN (all mode LED lamps are off)

By pressing START PB, START PB lamp will turn on that indicate start ready status. Next by JOG SW, decide the direction, the motor will scan.

It can be stopped by STOP PB or limit switches.

The start ready status can be cleared by STOP PB.

3) Channel selection

While pulse is not being sent, the channel you like to control can be changed by CH select SW in local mode. In the display, the position of the last selected motor is shown. If the SW is operated during pulse-sending, the operation will be ignored. Four display (A,B,C,D) can not control same channel at the same time.

The system are programmed that same CH can not be selected at the same time.

4) Jog driving

In the direction which is set by jog SW, pulses are sent and motor is driven.

If you keep the SW to be pushed more than 0.5 seconds, continuous scan is started.

5) Position data preset

Index data can be shown and set in the display by use of PR PB and A,B,C,D PB.

Table 1 speed data

No. 0		No.	PPS	No.	PPS	No.	PPS
1	5	30	3,700	60	9,000	90	18,660
1 1 1	10	31	3,800	61	9,200	91	18,940
2	25	32	3,900	62	9,400	92	19,230
3	50	33	4,000	63	9,600	93	19,530
4	75	34	4,100	64	9,800	94	19,840
5	100	35	4,200	65	10,000	95	20,160
6	150	36	4,300	66	10,200	96	20,500
7	200	37	4,400	67	10,400	97	20,830
8	250	38	4,500	68	10,600	98	21,190
9	300	39	4,600	69	10,800	99	21,550
Α	350	3A	4,700	6A	11,010	9A	21,930
В	400	3B	4,800	6B	11,210	9B	22,320
С	450	3C	4,900	6C	11,410	9C	22,730
D	500	3D	5,000	6D	11,600	9D	23,150
E	550	3E	5,100	6E	11,800	9E	23,590
F	600	3F	5,200	6F	11,990	9F	24,040
10	650	40	5,300	70	12,200	A0	24,510
11	700	41	5,400	71	12,400	A1	25,000
12	750	42	5,500	72	12,600	A2	25,510
13	800	43	5,600	73	12,790	А3	26,040
14	900	44	5,700	74	12,990	A4	26,600
15	1,000	45	5,800	75	13,200	A5	27,170
16	1,100	46	5,900	76	13,400	A6	27,620
17	1,200	47	6,000	77	13,620	A7	28,090
18	1,300	48	6,100	78	13,810	A8	28,570
19	1,400	49	6,200	79	14,000	A9	29,070
1A	1,500	4A	6,300	7A	14,200	AA	29,590
1B	1,600	4B	6,400	7B	14,400	AB	30,120
1C	1,700	4C	6,500	7C	14,620	AC	30,680
1D	1,800	4D	6,600	7D	14,830	AD	31,250
1E	1,900	4E	6,700	7E	15,010	AE	31,850
1F	2,000	4F	6,800	7F	15,200	AF	32,470
20	2,100	50	6,900	80	15,390	В0	33,110
21	2,200	51	7,000	81	15,580	B1	33,780
22	2,300	52	7,100	82	15,770	B2	34,480
23	2,400	53	7,200	83	15,970	В3	35,210
24	2,500	54	7,300	84	16,180	В4	35,970
25	2,600	55	7,400	85	16,400	B5	36,500
26	2,700	56	7,500	86	16,610	В6	37,040
27	2,800	57	7,600	87	16,830	В7	37,600
28	2,900	58	7,700	88	17,060	В8	38,170
29	3,000	59	7,800	89	17,240	В9	38,760
2A	3,100	5A	7,900	8A	17,420	ВА	39,370
2B	3,200	5B	8,000	8B	17,600	BB	40,000
2C	3,300	5C	8,200	8C	17,800		
2D	3,400	5D	8,400	8D	17,990		
2E	3,500	5E	8,600	8E	18,180		
2F	3,600	5F	8,800	8F	18,380		

Table 2 rate data

No.	mS/1000PPS
0	1,000.0
1	800.0
2	600.0
3	500.0
4	400.0
5	300.0
6	200.0
7	150.0
8	125.0
9	100.0
Α	75.0
B C	50.0
С	30.0
D	20.0
Е	15.0
F	10.0
10	7.5
11	5.0
12	4.0
13	2.0
14	1.5
15	1.0

Can be set in this range $H S P D = 0 \sim B B$ $M S P D = 0 \sim B B$ $L S P D = 0 \sim A 1$ $R A T E = 0 \sim 1 2$

6) Synchronous driving

A,B,C,D can be driven individually. When more than 2 motors are selected, they can be started synchronously at the same time by JOG, START switches.

7) Auto hold-off

If you set the motor hold off, the power of the motor is turned on only when the motor is being driven in local mode.

8) Inhibiting Jog

If you set the motor off, any operations shown above can't drive motors. (refer page 7 3-4)-G. LMSW)

9) Hand box operation

By use of hand box, you can drive motors while you watch the mechanical moving. Then, four CH displayed front panel can be operated as CW/CCW jog driving. You can change control CH on the front panel. In the HP mode, you can also operate by the hand box.

5 . Remote mode driving

This mode is possible when remote/local SW shows to be REMT.

If the remote/local SW shows LOCL, push the SW again or send the command externally to change the mode to be REMT. And, after that, continue to operate as below.

Remote mode driving can be operated by;


- 1 Parallel I/0
- 2 GP-IB
- 3 RS232C


Above 3 are common in PM16C-04 and PM16C-04S.

About the communication over Ethernet (LAN:10base-T, only for PM16C-04), see a separate volume.

These communication mode can be selected by setting SW of rear panel. (as shown below) The setting SW should be changed before power turned on if necessary.

1) External Communication over PIO port (omitted)

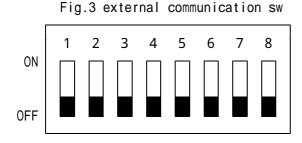

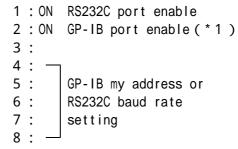

- * When both RS232C and GP-IB are ordered at the same time, only RS232C is selected.
- *1) By use of the optional handy console (PM16-HD1) connected to RS232C port in GP-IB mode, less than additional 6 motors can be controlled (position monitoring, jog, scan, REL. IDX, ABS IDX and preset) during GP-IB control.
- 2) RS232C, GP-IB data communication
 - a) Introduction

A PM16C-04 (or -04S) has a GP-IB control IC; TMS9914A. and has a RS232C control IC; HD64941. In this system, nonsense command or impossible command (EX. reverse drive during normal drive) are ignored so that almost all time you can access from these communication lines (protect from hung up).

Receive form should be S · · · · CR+LF*. :ASCII

* de-limitter is fixed to CR+LF.

When CR(ODH)+LF(OAH) is detected during receiving, the command is rapidly analyzed and done by PM16C-04 (or -04S). However, if it can't be analyzed, no operation is done. When PM16C receives information that some data should be returned back, the data are rapidly prepared and sent back. These operations are done for about less than 1mS.

Drive command form is; R · · · · CR+LF.

Remote controls such as receiving, analyzing and doing from RS232C/GPIB line are operated by interrupting in PM16C-04 (or -04S). Therefore, these operations need not have waiting time.

Then, three types of commands are possible.


TYPE 1:rapid done · · · data reading/motor stop

TYPE 2:waiting for some status done · · · CH select

TYPE 3:some status requiring done · · · motor control

In the case of that the data are read out after sending the command of TYPE 2/3, it is important as above shown.

- b) Baud rate /address set SW: as above mentioned
- c) character structure
 - 1.RS232C data are 1 START bit +8 bit data +1stop bit no parity (fixed)
 - 2.De-limitter is fixed to be CR+LF.
 - 3. Send/receive command code is ASCII.
- d) In RS232C communication, software hand shake (XON, XOFF) is not supported.
- e) Connection between PM16C and other controller (in the case of RS232C. GP-IB is omitted here.)

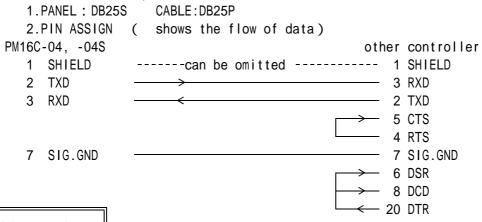

RS23C2C debug tool

If RS232C line can not work well, the cause of that is hard to be found. Therefore, we prepared the tool for helping to solve these problems. Please keep the stop PB on while power is turned on, then received character is displayed echo back. You can refer the character and get some information about the problem you meet. If echo back is not well displayed, the RS232C line is possible to be badly wired. Or, if you get curious characters, baud rate and parity should be examined.


- 2-1) Command in detail (for both RS232C and GP-IB)
 - a) Channel select, channel read and remote/local change command
 - If these commands are received during pulse sending,

any operations are not started before finishing the pulse out.

It is enable only in REMT mode.

CH reading out and REM/LOCL changing can be operated both in remote/local. Data are read out as the receive form below.

command form

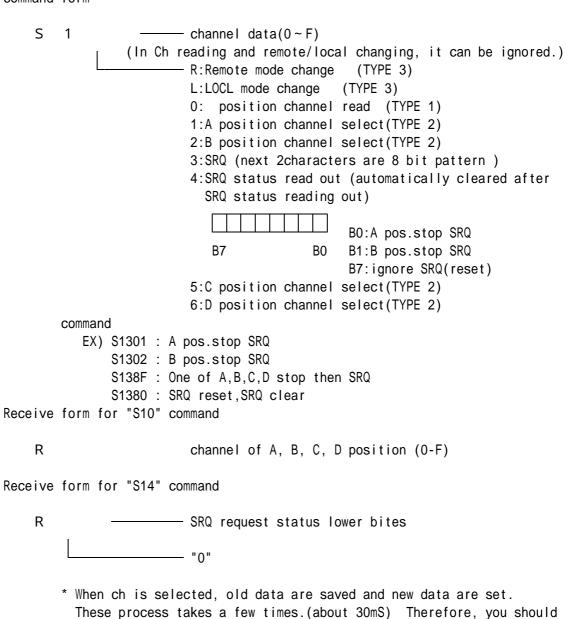

b) Data & status read command

At any time, position data and status are usually read out by this command. This is enable in whichever modes remote/local.

send the command after completing the ch selection . The completing can be known by Ch reading out command.

command form

S 2 — 0:A position data read (TYPE 1) 1:A position status read(") 2:B position data read (") 3:B position status read(")
4:C position data read (")
5:C position status read(")
6:D position data read (")
7:D position status read(")

* Can get decimal data by adding "D" to the command when you send the position read out command. ex) S20D


Receive form

R position data (2's compliment of 6 hex code)

HEX CODE ASCII

R Status data(2 hex code)

HEX CODE ASCII

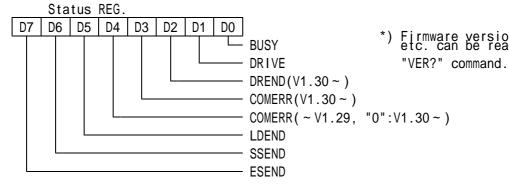

BUSY: shows Pulse controller is being operated now. During the moving, speed change and pulse out command are ignored, though slow stop and EM stop command are effective. BUSY status of OD17 shows CPU status which controls hole of the system. On the other hand, the BUSY here shows four CPU's status (A,B,C,D) which control A, B, C, D motors.

DRIVE : Pulse out is being continued.

COMERR : The command is nonsense.

DREND : Pulse out drive finished.

LDEND : Pulse out is stopped by CWLS and CCWLS.

SSEND : Pulse out is slowly stopped by slow stop command.

ESEND : Pulse out is rapidly stopped by EM stop command.


caution) COMERR, LSEND, SSEND and ESEND are enable, only if BUSY=0.

These bits are cleared by rewriting the next command.

LSEND, SSEND and ESEND bit are nonsense, when pulse are not sent out by the command.

c) Motor control command

Data and command are written for A, B, C, D position control 2 bytes command form

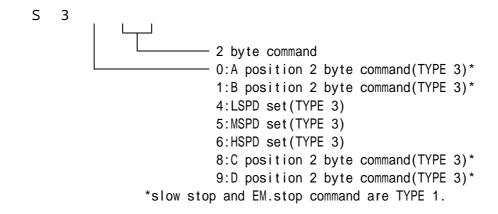

+,- jog command command for jog drive

command

08 :+(CW) jog drive 09 :-(CCW) jog drive

+,- constant speed scan command

By this command, motor speed is set to be constant value which is preset (*) as you like.

command

OC :+(CW) constant scan drive

OD :- (CCW) constant scan drive

* The speed is set at the value which is last selected by push SW (H,M and L) in LOCL mode, or which is last selected by speed select command in REMT mode.

This procedure is same in other controls shown below.

+, - scan command

Motor speed is increased from LSPD to set value as trapezoidal driving.

command

OE :+(CW) scan drive OF :-(CCW) scan drive

speed selection command

By this command, the motor speed is selected from HSPD, MSPD or LSPD. All A. B. C. D POS are set as same range.

This command is effective for the channel whose motor remains stationary. The channel of the moving motor is kept to the old range.

command

EX) S34 : LSPD select S35 : MSPD select S36 : HSPD select

Commands for synchronous starting of more than one motor
The pause command should be sent to PM16C before starting of more than
one motor at the same time.(*) If jog command is sent after pause
command, motors can not be driven until pause off command.

command

16 : pause17 : pause off

EX) S3X16 : pause S3X17 : pause off

* The sequence of Synchronous start is that; 16H(pause) is given to the each controller, and after that, 17H(pause off) is given to start more than one motor synchronously.

The third character(X) shows channel, and then 0, 1, 8 and 9 are effective for all A, B, C, D.

These commands don't give any effects to the motors that are already moving.

hold off set/rest command command

18 : hold off set19 : hold off reset

EX) S3018: A pos.hold off set S3019: A pos.hold off reset S3118: B pos.hold off set

* When you need to start the motor from the state of hold off, you should cancel the hold off state enough time before sending the control pulse in accordance with motor's character.

Of course, when you set hold off again, you should send the command enough time after finishing to send the control pulse.

scan & HP stop command

By this command, scan and home position LS detection are done. After stopping, if HP sensor works home position data (position, HP sensing direction, HP detection) are memorized.

command

1E : +scan & HP stop 1F : -scan & HP stop

EX) S301E : A pos. +scan & HP stop

slow stop command

Velocity is decreased by the rate whose value is preset.

command

40 : slow stop

EX) \$3040 : A pos.slow stop

EM stop command


by this command, pulse out is rapidly stopped.

Care for motor speed, because motor is possible to be detuned.

80 : EM stop

EX) S3180 : B pos. EM stop

8 bytes command form (TYPE 3)

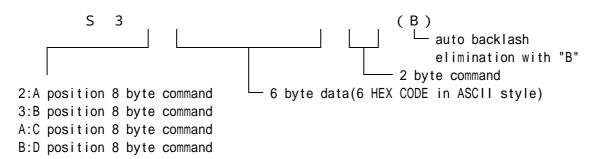

constant speed relative index scan

Motor is driven at the preset constant speed.

Adding "B" after the last character, the motor will move in backlash elimination mode.

command

10 : constant speed REL.IX drive
$$2^{2^2} \sim 2^{16}$$
 $2^7 \sim 2^9$ (data3) (data1) $2^{15} \sim 2^8$ (data2)

Sample(Out put pulse is 2's complement)

PULSE OUT	data 1	data 2	data 3
0	00H	00H	00H
(CW) +10	00H	00H	0AH
(CW)+8,388,607	7FH	FFH	FFH
(CCW) -10	FFH	FFH	F6H
(CCW)-8,388,608	80H	00H	00H

constant speed absolute index command

By this command, motor is driven at preset constant speed.

Adding "B" after the last character, the motor will move in backlash elimination mode.

command

11 : constant speed ABS.IX drive
$$2^{2^2} \sim 2^{16}$$
 $2^7 \sim 2^9$ (data3) (data1) $2^{15} \sim 2^8$ (data2)

Setting sample

Destination address is shown as 2's complement

destination	data 1	data 2	data 3
0	00H	00H	00H
+10	00H	00H	OAH
+8,388,607	7FH	FFH	FFH
-10	FFH	FFH	F6H
-8,388,608	80H	00H	00H

*caution: When absolute command is done, it is doubtful that display counter and control counter are different from each other. Then, the values are not coincident. In such cases, please select the channel again. That case might be happened when the nonsense command is used.

incremental index command

Relative setting index drive is done by this command.

The speed is increased and decreased between LSPD and MSPD.

Adding "B" after the last character, the motor will move in backlash elimination mode.

command

12 : incremental IDX. drive

$$2^{22} \sim 2^{16}$$
 $2^{7} \sim 2^{0}$ (data3) (data1) $2^{15} \sim 2^{8}$ (data2)

pulse counts are shown as 2's complement

setting sample

pulse out	data 1	data 2	data 3
0	00H	00H	00H
(CW) +10	00H	00H	OAH
(CW)+8,388,607	7FH	FFH	FFH
(CCW) -10	FFH	FFH	F6H
(CCW)-8,388,608	80H	00H	00H

absolute index command

Absolute setting index drive is done by this command.

The motor speed is increased and decreased between LSPD and MSPD. command

13 : incremental IDX. drive $2^{22} \sim 2^{16}$ $2^{7} \sim 2^{0}$ (data3)

Destination is shown as 2's complement.

sample

destination	data 1	data 2	data 3
0	00H	00H	00H
+10	00H	00H	OAH
+8,388,607	7FH	FFH	FFH
-10	FFH	FFH	F6H
-8,388,608	80H	00H	00H

^{*}caution: When absolute command is done, it is doubtful that display counter and control counter are different from each other. Then, the values are not coincident. In such cases, please select the channel again. That case might be happened when the nonsense command is used.

Other commands

In scan drive moving or index drive moving, the moving speed can be changed between 10 pps to setting speed in pps unit.

It is possible only over external communication line.


command form

S P C X D D D D D X:position A, B, C, D D:5 digit decimal data

After receiving the command the speed increases or decreases tarpezoidally.

d) Data read out command

Each channel is read out by this command, which is enable both in REMT and LOCL modes.

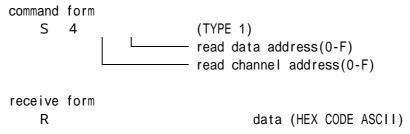

3 bytes are returned from read data address.

```
data address
                  contents
             position data(16<sup>5</sup>,16<sup>4</sup>)
       0
       1
                           (16^3, 16^2)
       2
                           (16^1, 16^0)
                  "
             digital CWLS (165,164)
       3
       4
                           (16^3, 16^2)
       5
                           (16^{1}, 16^{0})
                  "
             digital CCWLS(16<sup>5</sup>,16<sup>4</sup>)
       6
       7
                  "
                           (16^3, 16^2)
                           (16^1, 16^0)
       8
                  "
       9
                           HSPD
                           MSPD
       $A
                           LSPD
       $B
       $C
                           RATE
                           LMSW etc.
       $D
                                 b0:CW LS A/B
                                 b1:CCWLS A/B
                                 b2:Z LS A/B
                                 b3:CW LS enable
                                 b4:CCWLS enable
                                 b5:digital LS enable
                                b6:hold (1:0N 0:0FF)
                                 b7:motor off
                                                   jog pulse counts
       $E jog pulse counts
                                                              MDA+$E
       $F
                                                              MDA+$F
pps unit speed data read out
  HSPD read out
    command form
         SPH?X
                     read channel address(0-F)
    receive form
        RDDDDDD
                           D: ASCII 5 digit decimal data
  MSPD read out
    command form
         SPM?X
                    — read channel address(0-F)
    receive form
        RDDDDD D: ASCII 5 digit decimal data
  LSPD read out
    command form
         SPL?X
                     read channel address(0-F)
    receive form
                            D: ASCII 5 digit decimal data
        RDDDDD
```

e) Data write on command

By this command, basic data stored in each ch can be rewritten. This is enable in REMT mode. However, speed data cannot be rewritten while motor is driving, and the data are rewritten automatically after stopping the motor.

command form S 5 (TYPE 1) write data(2 HEX CODE in ASCII style) - write data address(0-F) write channel address(0-F) pps unit speed data write on HSPD write on command form SPHXDDDDD D:ASCII 5 digit decimal data write channel address(0-F) MSPD write on command form SPMXDDDDD D:ASCII 5 digit decimal data write channel address(0-F) LSPD write on command form SPLXDDDDD D:ASCII 5 digit decimal data

f) Limit SW & remote/local mode read

By this command, LS status and remote/local mode status are read out in any time. However, it is required for approximately 30ms that the ch is changed by the command. In LS status read, more 10mS is required.

- write channel address(0-F)

```
command form
                 (TYPE 1)
    S
        6
receive form
                            data (HEX CODE in ASCII style)
    R
            BF:
            BE:B POS H.P
                           ON : 0
                                          upper HEX CODE
           BD:B POS CCW LS ON : 0
            BC:B POS CW LS ON : 0
            BB:CPU/MANU STATUS(1:CPU)
            BA:A POS H.P
                           ON : 0
            B9:A POS CCW LS ON : 0
                                            caution)
            B8:A POS CW LS ON : 0
                                             For compatibility to the
            B7:
                                             PM16C-02Z(or N), the order
            B6:D POS H.P
                           ON : 0
                                             of the data are B, A, D, C.
            B5:D POS CCW LS ON : 0
            B4:D POS CW LS ON : 0
            B3:
            B2:C POS H.P
                            ON : 0
                                          lower HEX CODE
            B1:C POS CCW LS ON : 0
            BO:C POS CW LS ON : 0
```

- 2-2) Procedure of data communication over GP-IB, RS232C or LAN communication ports.
 -) External controller gives the command to GP-IB, RS232C, LAN ports.
 -) When all command is received by PM16C-04(or 04S), analyzed and driven rapidly. Time for doing the command is varied for status of system, for command types, etc.
 -) In command with receiving operation, data prepared by the command is returned back to the external controller when PM16C-04(or 04S) is set as a talker.
 -) All command can be sent as the form which is divided by comma(","). In receiving data, comma is recognized as the pause between two commands. Then, each command is rapidly recognized and done. If there are non-sense commands, they are ignored.(EX. scan command during moving) There are some commands which requires some time for operating.
 - EX.) When you want to set 3ch to A position, and A ch to B position: S 1 1 3 , S 1 2 A RETURN+LF
- 2-3) Sample Program of data communication(address of PM16C02Z:7,delimiter:CR+LF)
 - a)select A position as 8 CH

PRINT@ 7; "S118"

b)select B position as C CH

PRINT@ 7; "S12C"

c) + scan is operated in A position

PRINT@ 7; "S300E"

d)write 80H to 5 ch address 9 data(HSPD)

PRINT@ 7: "S55980"

e)read out the present A position pulse count

PRINT@ 7; "S20" :data read out command

INPUT@ 7,1;A\$:data input PRINT A\$:data print

6 . Auto Backlash Elimination

It can be operated over GP-IB , RS232C or LAN communication lines.

1) What is the Auto Backlash Elimination

By this function, you can preset the value of elimination step, then motor is driven to position where you want to stop the motor after the elimination step driving. For example; If you set $-5\ 0\ 0\ 0$ as the elimination step, at first the motor is driven to the position where the count is X-5000. And after that, the motor is driven back to the position for $+5\ 0\ 0\ 0$ steps, then driving is finished to reach the position of X.

If the elimination step is +, the motor approaches to the final point from + site.(if the elimination step is -, the motor approaches to the final point from - site.)

By this function, backlash of the mechanics is eliminated.

2) Command Reference

2-1) elimination step count set(kept by battery back up)

set command

 $BX \pm DDDD$

B :elimination step count

X : channel $(0 \sim F)$

± :+ or -

(direction from which motor is driven to approach the final position)

DDDD :decimal counts(0000 ~ 9999)

example

B0+5000, BF-3000

```
2-2) read out the elimination step counts(it's read out any time you can.)
read out command
BX?
reply
±DDDD

± :+ or -(approach direction)
DDDD :decimal count(0000~9999)
example
B0?
BF?
reply
+5000
-3000
```

2-3) auto backlash eliminative driving move command

Auto backlash eliminative driving can be operated by adding "B" to A/B position 8 byte command.

ex) S32XXXXXX B

S32 :A position 8 byte-command XXXXXX:driving data(HEX)

:command(relative driving, absolute driving)

B :auto backlash elimination is operated.

ex) S33XXXXXX B

S33 :B position 8 byte-command XXXXXX:driving data(HEX)

:command(relative driving, absolute driving)

B :auto backlash elimination is operated.

- 3) When you use backlash elimination;
 - 1. If the stop command is sent to PM16C externally, or front panel stop SW, the motor is slowly stopped at the point.

After that, the backlash elimination sequence is normally cancelled.

- 2. If you have set the stopping SRQ, the SRQ is expressed after motor stopping.
- 3. During the sequence of backlash elimination, if LS in driving direction is struck, the motor is slowly stopped and after that the sequences cancelled.
- 4.By addition of this function, the direction of motor driving become to be more complex, therefore limit SW setting should be required to be care.
- 7 . Home position detection in remote mode.

omitted

8 . 16 bit digital data IN/OUT omitted

9 . Version information

Can read out the version information for the firmware.

```
read out command
VER?
reply
"1.10 01-03-08"
It means Ver.1.10 and registered on the date, 2001-03-08.
```

10 . Another added command omitted

11. Additional function

Pulse output change

PM16C-04, -04S has two pulse output styles for the Driver's requirement.

One is CW pulse + CCW pulse style (P-P style) and the other is pulse + direction (P-D style).

PM16C-04, -04S is set P-P style as a default setting when shipping.

This function can change the pulse output style if necessary.

The pulse output style is set to A, B, C and D position control IC in the PM16C individually.


So you can set P-P style to A, B position and P-D style to C, D position, for example. The motor control using one control window (ex. A position) is the same style pulse output instead of selected channels.

A, B, C and D position control can also be set to P-D style all.

Setting check and change

- 1. Press SETUP button in local mode and go into setup mode.
- 2. When pressing the REM/LOC button, A, B, C and D control button lamp indicate the pulse output style.
 - If the lamp off, the button indicate P-P style and if the lamp on, the button indicate P-D style. (Confirmation pulse output style)
- 3. While pressing the REM/LOC button, pressing A, B, C or D button cause the change of lamp on/off status alternately. (Change of pulse output style)
- 4. If the setting is changed, new setting will be valid after next power on. The pulse output style will be memorized by the backup battery.

12.connection with outer equipment1) connection with drivers

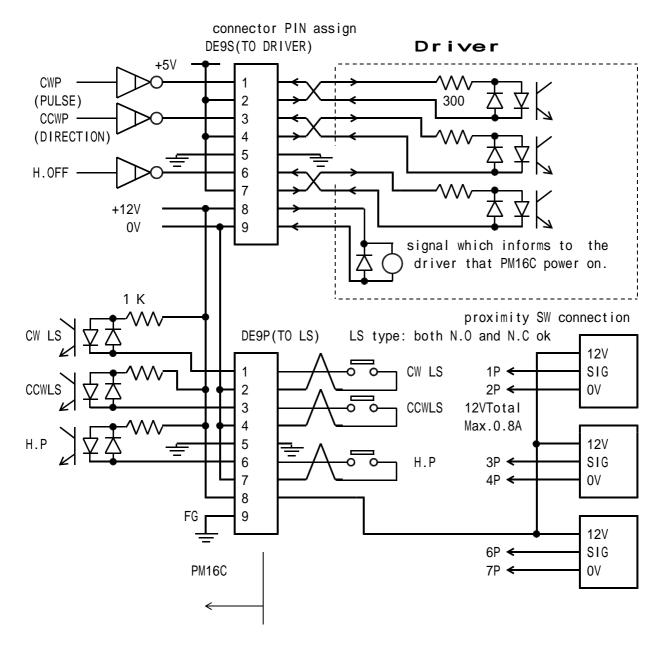

caution) Connector shell size of DE9P and 9S is varied from each maker's.

Outward form <35W can be used for PM16C.

DE-C1-J6(JAE), XM2S-0911(OMRON) and HDE-CTF(HIROSE) are possible to be used.

13. Specifications.

Power	AC 85V ~ 264V 47 - 440Hz 50VA		
IN/OUT -	control	1 6 motors can be controlled.	
	capability	4 motors can be controlled synchronously.	
	out put	CW, CCW, HOLD OFF(5V 8mA:plus common) for each 16 motor driver.	
	pulse rate	1~100KPPS	
	pulse con.	D sub 9 S (female)	
	limit sw input	CW-LS, CCW-LS, HOME-LS 12V 5mA(minus common) and power supply +12V for sensor (total 1A) for each motor	
	limit sw con.	D sub 9 P (male)	
display	position	7 digit position display For each 4ch(A,B,C,D)	
	channe I	1 digit channel display For each 4ch(A,B,C,D)	
digital sw	±7 digit digital sw	counter preset, relative data for REL and ABS index moving digital limit data set, PPS unit speed set,offset data for HP detection For each 4ch(A,B,C,D)	
ch.sel.sw		call channel to the four control windows(A,B,C,D)	
ctl.sel.sw		decide control enable/disable for A,B,C,D control	
	PRESET	preset digital sw data to the selected display	
control	START	moving start for selected channel according to the mode	
control	STOP	stop moving for selected channel	
	JOG	jog stepping for selected channel	
step mode	SCAN MODE	continuous scan for selected channel. directed by JOG sw	
	ABS IDX MODE	moving to the indicated position by the digital sw	
	REL IDX MODE	moving indicated value by the digital sw	
	HP STOP MODE	stop by Home Position Limit Sw total 3 moving style. 1 is for with HP detection memory,a and 2 is for without HP detection memory	
speed sel.	select L, M, H speed. can set freely for each channel		
rem.control	remote control over PIO, GP-IB, RS232C port(further Ethernet for PM16C-04)		
cace	EIA 3 UNIT rack mount type (132H×482W×420D)		

For the other information, feel free to ask us.

Tsuji Electronics Co., Ltd.

Tel:+81-(0)29-832-3031 Fax:+81-(0)29-832-2662

E-mail: info2@tsuji-denshi.co.jp

URL : http://www.tsuji-denshi.co.jp

3739, Kandatsu-machi, Tsuchiura-city, Ibaraki 300-0013, Japan